

This Service Letter reidentified as
Service Bulletin M 20-127
per Service Instruction M20-15.

SUBJECT: Inspection of Hartzell Propellers and Installation
of Mooney Decal

MODEL AFFECTED: M20E, S/N 101 - 722

TIME OF COMPLIANCE: Within next 25 hours of operation

INTRODUCTION: It will be necessary for the owners of the above aircraft to inspect propeller blades and install the Mooney decal 150010-65 on the tachometer.

- INSTRUCTIONS:**
1. Wash the Bezel glass with alcohol.
 2. Apply 150010-65 decal as shown in Figure 1.
 3. Inspect blades for nicks. If nicks are present, inspect blades for cracks by dye penetrant method. Replace blade or propeller if cracks are present in blade or blades. If cracks are not present in the blades, remove nicks from the propeller blade per Hartzell Bulletin No. 31.
 4. Make log book entry to show compliance with this Service Letter.

COMPLIANCE: Upon compliance of this Service Letter, please fill out the enclosed compliance card and return it to Mooney Aircraft, Inc. for our files.

SERVICE LETTER KIT 20-127

PARTS LIST

Flight Manual Log of Revisions Sheet	1
Sheet 1 of Flight Manual	1
Hartzell Service Bulletins No. 31 and 89	1 each
150010-65 Decal	

NOTE: This Service Letter is mandatory to the above listed aircraft and an airworthiness directive will be issued on the above aircraft to insure total compliance.

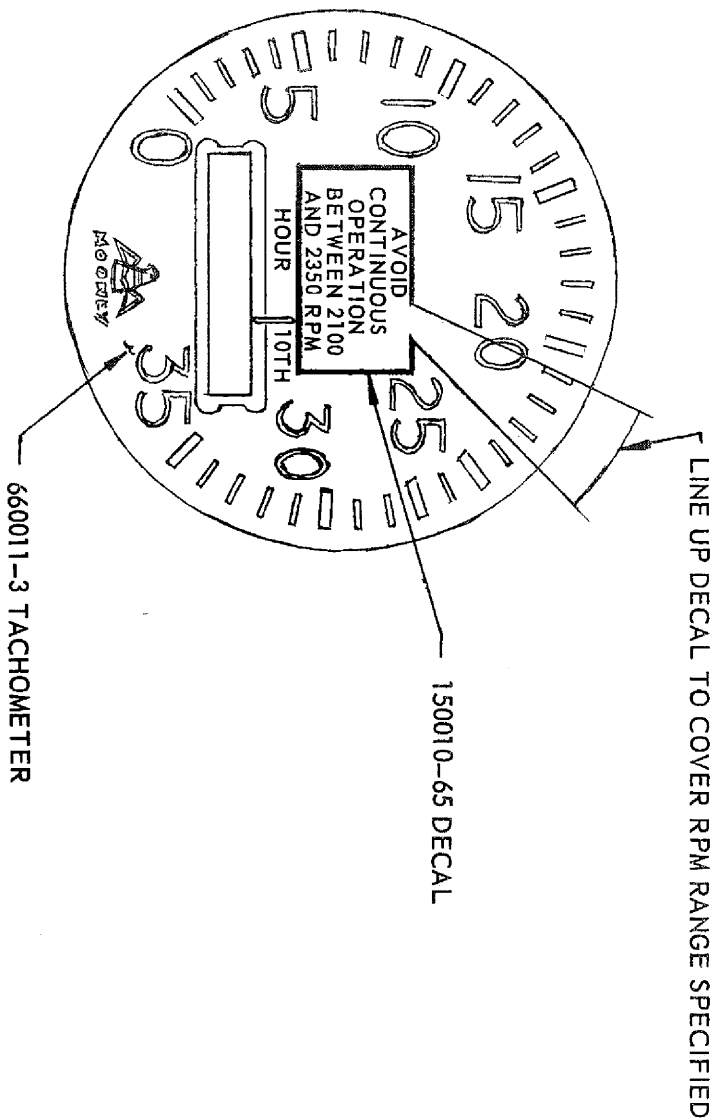


FIGURE # 1