



(This Service Letter is FAA/DMCR SW-1 Approved)

SUBJECT: Fuel Manifold Drain
MODELS AFFECTED: M20E S/N 231 thru 746
TIME OF COMPLIANCE: At the next 100 hour inspection

This Service Letter reidentified as
Service Bulletin M 20-132
per Service Instruction M20-15.

INTRODUCTION: It is suggested that the owners of the above mentioned aircraft comply with this service letter to increase the hose service life.

- INSTRUCTIONS:
1. Remove right and left side engine cowls.
 2. Disconnect 610034-39 hose from 610034-35 aluminum line.
 3. Disconnect 610034-35 aluminum line from 610041-1 fitting.
 4. Remove 610041-1 fitting presently installed in sump.
 5. Install 610122 fitting in sump.
 6. Install 610034-35 aluminum line in 610122 fitting.
 7. Install 610034-51 hose on 610034-35 aluminum line making sure all connections and clamps are tight and are as Figure 1.
 8. Reinstall right and left side engine cowls previously removed.

COMPLIANCE: Upon compliance of this Service Letter, please fill out the enclosed compliance card and return it to Mooney Aircraft, Inc. for our files.

SERVICE LETTER KIT:

PARTS LIST

610034-51 Hose
610122 Fitting

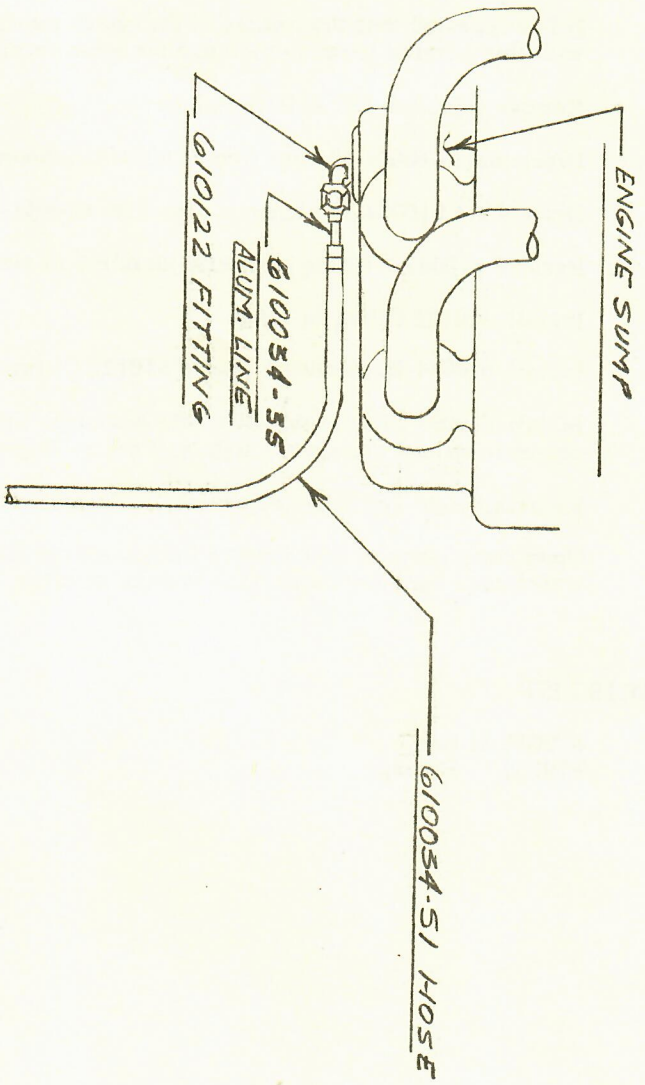


FIGURE 1.

SERVICE LETTER NO. 20-132

3